




Metal Halide Lamp Ballast

Catalog Number 79W6586
For 1000W CSI
60 Hz CWA
Status: Active

DIMENSIONS AND DATA

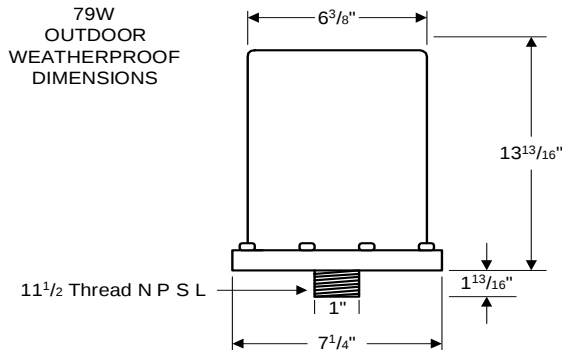

INPUT VOLTS	120	277			
CIRCUIT TYPE	CWA				
POWER FACTOR (min)	90%				
REGULATION					
Line Volts	±10%				
Lamp Watts	±10%				
LINE CURRENT (Amps)					
Operating.....	9.80	4.20			
Open Circuit.....	9.40	4.00			
Starting.....	8.50	3.60			
UL TEMPERATURE RATINGS					
Insulation Class	H(180°C)				
Coil Temperature Code	1029				
MIN. AMBIENT STARTING TEMP.	-40°F or -40°C				
NOM. OPEN CIRCUIT VOLTAGE	200				
INPUT VOLTAGE AT LAMP DROPOUT.....	50	100			
INPUT WATTS	1140				
RECOMMENDED FUSE (Amps).....	25	15			
CORE and COIL					
Dimension (A)					
Dimension (B)					
Weight (lbs.)	30				
Lead Lengths	10"				
CAPACITOR REQUIREMENT					
Microfarads	165.0				
Volts (min.)	280				
Fault Current Withstand (amps)					
60 Hz TEST PROCEDURES (Refer to Advance Test Procedure for HID Ballasts - Form 1270)					
High Potential Test (Volts)					
1 minute	2000				
2 seconds	2500				
Open Circuit Voltage Test (Volts)	180-220				
Short-Circuit Current Test (Amps)					
Secondary Current	15.00-23.00				
Input Current.....	6.10-9.10	2.60-4.00	-	-	-

Capacitor:

The capacitor is included as part of the potted assembly.

Wiring Diagram:

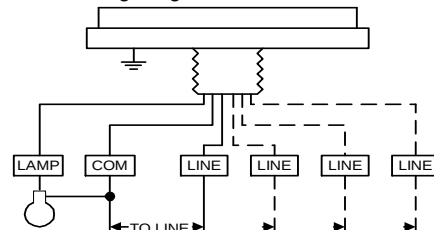


Fig. OW-2

Ordering Information

Order Suffix

Description

Ignitor:

CSI

Customer
Supplied
Ignitor

Data is based upon tests performed by Advance Transformer in a controlled environment and representative of relative performance. Actual performance can vary depending on operating conditions. Specifications are subject to change without notice.

ADVANCE TRANSFORMER CO.

O'HARE INTERNATIONAL CENTER · 10275 WEST HIGGINS ROAD · ROSEMONT, IL 60018
Customer Support/Technical Service: Phone: 800-372-3331 · Fax: 847-768-7768
Corporate Offices: Phone: 800-322-2086

10/18/11