




Metal Halide Lamp Ballast

Catalog Number 71A5953AEE
For 350W M131/M171 (P.S.)
60 Hz SUPER-CWA
Status: Active

DIMENSIONS AND DATA

4 1/4 X 4 3/4 CORE - 2 COIL UNIT

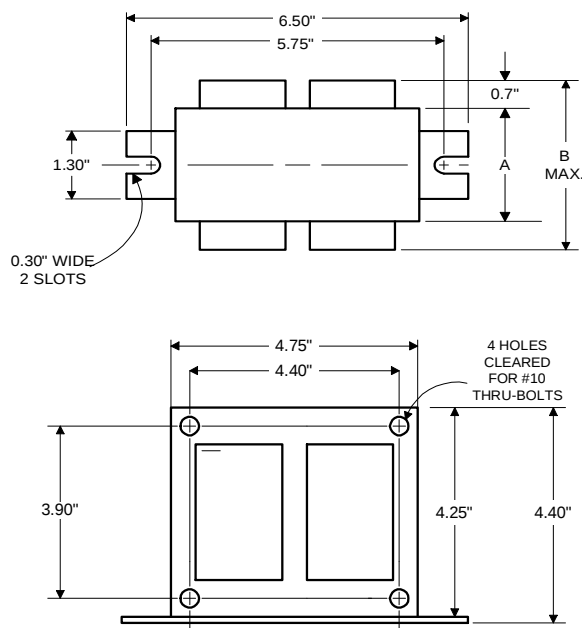


INPUT VOLTS	120	208	240	277	480
CIRCUIT TYPE	SUPER-CWA				
POWER FACTOR (min)	90%				
REGULATION					
Line Volts	±10%				
Lamp Watts	±10%				
LINE CURRENT (Amps)					
Operating.....	3.40	2.00	1.70	1.50	0.85
Open Circuit.....	2.00	1.30	1.00	0.90	0.50
Starting.....	2.40	1.40	1.25	1.01	0.65
UL TEMPERATURE RATINGS					
Insulation Class	H(180°C)				
Coil Temperature Code	1029				
MIN. AMBIENT STARTING TEMP.	-20°F or -30°C				
NOM. OPEN CIRCUIT VOLTAGE	290				
INPUT VOLTAGE AT LAMP DROPOUT.....	60	104	120	139	240
INPUT WATTS	397				
RECOMMENDED FUSE (Amps).....	10	7	5	5	3
CORE and COIL					
Dimension (A)	2.20				
Dimension (B)	4.10				
Weight (lbs.)	11.2				
Lead Lengths	12"				
CAPACITOR REQUIREMENT					
Microfarads	22.5				
Volts (min.)	345				
Fault Current Withstand (amps)					
60 Hz TEST PROCEDURES (Refer to Advance Test Procedure for HID Ballasts - Form 1270)					
High Potential Test (Volts)					
1 minute	2000				
2 seconds	2500				
Open Circuit Voltage Test (Volts)	270-315				
Short-Circuit Current Test (Amps)					
Secondary Current	3.15-3.85				
Input Current.....	1.90-2.90	1.10-1.70	1.00-1.50	0.85-1.35	0.50-0.80

Capacitor: 7C225P40



Capacitance: 22.5
Dia/Oval Dim: 1.75
Height: 4.8
Temp Rating: 105°C

Wiring Diagram:

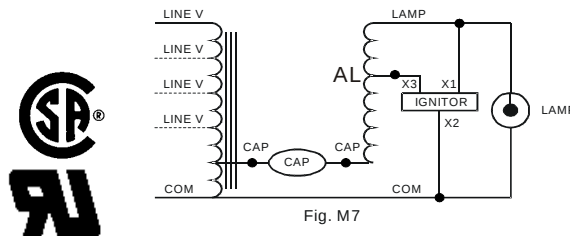

Ordering Information

Order Suffix	Description
EE	EISA COMPLIANT - 88% EFFICIENT BALLAST

Ignitor: LI533-H4



Ballast to Lamp Distance
(BTL) = 2 feet
Temp Rating: 105°C

Data is based upon tests performed by Advance Transformer in a controlled environment and representative of relative performance. Actual performance can vary depending on operating conditions. Specifications are subject to change without notice.

ADVANCE TRANSFORMER CO.

O'HARE INTERNATIONAL CENTER · 10275 WEST HIGGINS ROAD · ROSEMONT, IL 60018
Customer Support/Technical Service: Phone: 800-372-3331 · Fax: 847-768-7768
Corporate Offices: Phone: 800-322-2086

10/26/09